

MIDWEST AUTOMOTIVE & DIESEL

Invoice

1306 N. PROSPECT

Champaign, IL 61820

Shop Phone: (217) 352-7343

Fax: (217) 352-7366

Email: MIDWESTAAD@AOL.COM

1858

Estimate Ref #0

Date Printed: 06/28/2011

Printed Time: 5:25 pm

Hat/Ref: 7282

Time Promised:

2001 FORD EXCURSION LIMITED V8 7.3L 445CID FI DIESEL T F

VIN: 1FMSU43F11EB99192

License:

Mileage In: 228,713

Date Written: 06/01/2011

Unit #:

Mileage Out: 228,713

Written By: JASON

DOM:

Save Old Parts: No

Job Name	Description	Technician	Qty	List	Extended
Job #1	MULTIPOINT VEHICLE INSPECTION	ED			
Labor A	Work Requested - MULTIPOINT VEHICLE INSPECTION				0.00
Part BL3Z4676A	REAR PINION SEAL		1.00	18.48	18.48
Job #2	FRONT GRILL IS DAMAGED	ED			
Labor A	Work Requested - FRONT GRILL IS DAMAGED				37.00
Work Performed - INSTALLED NEW FRONT GRILLE AND FORD EMBLEM					
Part 1C7Z8200AAA	FRONT GRILLE ASSEMBLY		1.00	394.40	394.40
Part F81Z8213AB	EMBLEM		1.00	29.08	29.08
Part PMP195006938A	TOUCH UP PAINT		1.00	10.00	10.00
Job #3	CUT AND PROGRAM 2 EXTRA KEYS,	MATT			
	SET DOOR CODE T...				
Labor A	Work Requested - CUT AND PROGRAM 2 EXTRA KEYS, SET DOOR CODE TO # 15719				74.00
Work Performed - CUT AND PROGRAMMED 2 EXTRA KEYS AND 2 EXTRA REMOTES, SET DOOR ENTRY CODE TO # 15719 AS PER CUSTOMER REQUEST.					
Part F87Z15K601AA	REMOTE ENTRY TRANSMITTER		2.00	76.25	152.50
Part H86-PT	PATS KEY		2.00	29.95	59.90
Job #4		MATT			
Sublet	Work Requested - REAR SEAT IS TORN		1.00	135.00	135.00
Work Performed - PERFORMED LEATHER REPAIR ON LEFT SIDE 2ND ROW SEAT					
Job #5	OIL AND COOLANT LEAKING FROM	ED			
	MULTIPLE POINTS ...				
Labor A	Work Requested - OIL AND COOLANT LEAKING FROM MULTIPLE POINTS ON ENGINE				2,960.00
Work Performed - PERFORMED PRESSURE TESTS, FOUND COOLANT LEAK FROM WATER PUMP AND THERMOSTAT HOUSING, FOUND ENGINE OIL LEAK FROM FRONT AND REAR ENGINE COVERS, CHARGE AIR COOLER TUBES, HIGH PRESSURE OIL PUMP, INTAKE MANIFOLD, AND VALVE COVERS. REMOVED AND DISASSEMBLED ENGINE. CLEANED ALL COMPONENTS, REPLACED ALL FRONT COVER GASKETS, REAR COVER GASKETS, INTAKE MANIFOLD GASKETS, TURBO GASKETS, HIGH PRESSURE OIL PUMP SEALS, REPLACED ALL CHARGE AIR COOLER TUBES, AND ALL OTHER NECESSARY GASKETS TO RESEAL ALL ENGINE LEAKS. COMPLETELY RESEALED ENTIRE ENGINE AND REINSTALLED ENGINE INTO VEHICLE. PERFORMED UPDATE AND RECALIBRATION ON POWERTRAIN CONTROL MODULE, TRANSMISSION CONTROL MODULE, AND FUEL INJECTOR CONTROL MODULE TO BRING THEM TO LATEST UPDATED PROGRAMS.					
Part 30929	GASKET		1.00	3.19	3.19
Part F81Z8501FA	WATER PUMP		1.00	294.97	294.97
Part F81Z8592AA	OUTLET TUBE		1.00	41.43	41.43

MIDWEST AUTOMOTIVE & DIESEL

1306 N. PROSPECT
Champaign, IL 61820
Shop Phone: (217) 352-7343
Fax: (217) 352-7366
Email: MIDWESTAAD@AOL.COM

Invoice

1858

Estimate Ref #0
Date Printed: 06/28/2011
Printed Time: 5:25 pm

Hat/Ref: 7282

Time Promised:

2001 FORD EXCURSION LIMITED V8 7.3L 445CID FI DIESEL T F

VIN: 1FMSU43F11EB99192

License:

Mileage In: 228,713

Date Written: 06/01/2011

Unit #:

Mileage Out: 228,713

Written By: JASON

DOM:

Save Old Parts: No

Part	F6TZ8575EA	THERMOSTAT	1.00	39.88	39.88
Part	YC3Z8286CE	RADIATOR HOSE	1.00	49.72	49.72
Part	1C3Z6K649BA	O-RING	2.00	13.79	27.58
Part	1C3Z6C610BA	O-RING	2.00	6.89	13.78
Part	YC3Z6020BA	TIMING COVER GASKET	1.00	115.45	115.45
Part	F4TZ6700A	FRONT CRANKSHAFT OIL SEAL	1.00	33.33	33.33
Part	F4TZ6701A	REAR CRANKSHAFT OIL SEAL	1.00	78.33	78.33
Part	F4TZ6N640B	GASKET	1.00	11.61	11.61
Part	F81Z6N653BA	GASKET	1.00	91.63	91.63
Part	F81Z6584AA	VALVE COVER GASKET	2.00	96.45	192.90
Part	BRKLN	PARTS SOLVENT	4.00	9.95	39.80
Part	F4TZ6A636A	GASKET	1.00	19.46	19.46
Part	F7TZ6A636AAA	GASKET	1.00	28.82	28.82
Part	F6TZ9417AA	GASKET	1.00	32.87	32.87
Part	TA-3173	SEALER	2.00	19.86	39.72
Part	1C3Z8592AA	CHARGE AIR COOLER TUBE	1.00	34.17	34.17
Part	F81Z9J338NA	CHARGE AIR COOLER TUBE	1.00	136.37	136.37

Job #6	AIR FILTER BOX IS BROKEN	MATT			
Labor A	Work Requested - AIR FILTER BOX IS BROKEN				74.00
Work Performed - REPLACED ENGINE AIR FILTER HOUSING ASSEMBLY AND AIR FILTER.					
Part	1C3Z9600AA	AIR CLEANED HOUSING	1.00	345.23	345.23

DIESEL LOF	REPLACED ENGINE OIL AND	ED			
	FILTER. LUBED ALL DRI...				
Labor B	Work Requested - LUBE, OIL, AND FILTER SERVICE (DIESEL)				0.75
Work Performed - REPLACED ENGINE OIL AND FILTER, LUBED ALL GREASED DRIVELINE COMPONENTS.					
Part	15-40	15W-40 ENGINE OIL	15.00	3.95	59.25
Part	R85734	ENGINE OIL FILTER	1.00	29.95	29.95

Job #7	BATTERY TERMINALS CORRODED	MATT			
Labor A	Work Requested - BATTERY TERMINALS CORRODED				74.00
Work Performed - CLEANED ALL BATTERY TERMINALS AND CONNECTIONS, REPLACED BOTH BATTERIES WITH THE LARGEST BATTERIES AVAILABLE. 850CCA. CHARGING SYSTEM IS OPERATING AS DESIGNED.					
Part	EXA6560P	EXIDE 850CCA BATTERY	2.00	159.95	319.90

MIDWEST AUTOMOTIVE & DIESEL

1306 N. PROSPECT
 Champaign, IL 61820
 Shop Phone: (217) 352-7343
 Fax: (217) 352-7366
 Email: MIDWESTAAD@AOL.COM

Invoice

1858

Estimate Ref #0
 Date Printed: 06/28/2011
 Printed Time: 5:25 pm

Hat/Ref: 7282

Time Promised:

2001 FORD EXCURSION LIMITED V8 7.3L 445CID FI DIESEL T F

VIN: 1FMSU43F11EB99192

License:

Mileage In: 228,713

Date Written: 06/01/2011

Unit #:

Mileage Out: 228,713

Written By: JASON

DOM:

Save Old Parts: No

Job #8 **STEERING HAS EXCESSIVE PLAY** **MATT**
 Labor A Work Requested - STEERING HAS EXCESSIVE PLAY 222.00
 Work Performed - FOUND STEERING GEAR BOX WORN CAUSING EXCESSIVE STEERING PLAY. REPLACED STEERING GEAR BOX ASSEMBLY
 Part YC3Z3504ABRM STEERING GEAR ASSEMBLY 1.00 281.31 281.31

Job #9 **POWER STEERING FLUID SERVICE** **MATT**
 Labor A Work Requested - POWER STEERING FLUID SERVICE 74.00
 Work Performed - FLUSHED OLD FLUID FROM POWER STEERING SYSTEM, REPLACED POWER STEERING FLUID AND BLED AIR FROM SYSTEM.
 Part 5360 POWER STEERING FLUID 2.00 9.95 19.90

Job #10 **COOLANT SYSTEM SERVICE** **MATT**
 Labor A Work Requested - COOLANT SYSTEM SERVICE 74.00
 Work Performed - FLUSHED OLD COOLANT AND DEPOSITS FROM SYSTEM, REPLACED ENGINE ANTIFREEZE/COOLANT.
 Part G-05 ENGINE COOLANT 3.00 22.95 68.85

Job #11 **FLUID LEAK FROM FRONT AXLE** **MATT**
 Labor A Work Requested - FLUID LEAK FROM FRONT AXLE 222.00
 Work Performed - FOUND RIGHT FRONT AXLE SEAL LEAKING FLUID AND BOTH FRONT HUB SEALS LEAKING FLUID. REMOVED RIGHT FRONT AXLE ASSEMBLY, REPLACED RIGHT FRONT AXLE SEAL, REINSTALLED AXLE AND REPLACED LEFT AND RIGHT FRONT AXLE HUB SEALS.
 Part F81Z3254CB AXLE SEAL 1.00 64.80 64.80
 Part F81Z4A322AA HUB SEAL 2.00 8.45 16.90
 Part F81Z1S175HCA HUB SEAL 1.00 29.82 29.82

Job #12 **FRONT AND REAR DIFFEREITIAL SERVICE** **MATT**
 Labor A Work Requested - FRONT AND REAR DIFFEREITIAL SERVICE 148.00
 Work Performed - REMOVED DIFFERENTIAL COVERS, INSPECTED AND NO EXCESSIVE WEAR IS PRESENT. REINSTALLED AND RE-SEALED BOTH DOFFERENTIAL COVERS, INSTALLED SYNTHETIC DIFFERENTIAL FLUID IN FRONT AND REAR, AND ADDED LIMITED SLIP ADDITIVE TO REAR DIFFERENTIAL AS PER FORD GUIDELINES.
 Part 75/140 SYNTHETIC DIFFERENTIAL FLUID 8.00 14.95 119.60
 Part XL-3 MOTORCRAFT FRICTION MODIFIER 1.00 16.25 16.25

Job #13 **4X4 TRANSFER CASE SERVICE** **MATT**
 Labor A Work Requested - 4X4 TRANSFER CASE SERVICE 74.00
 Work Performed - REMOVED OLD FLUID, REPLACED TRANSFER CASE FLUID AND RESEALED TRANSFER CASE ASSEMBLY

MIDWEST AUTOMOTIVE & DIESEL

1306 N. PROSPECT
 Champaign, IL 61820
 Shop Phone: (217) 352-7343
 Fax: (217) 352-7366
 Email: MIDWESTAAD@AOL.COM

Invoice

1858

Estimate Ref #0
 Date Printed: 06/28/2011
 Printed Time: 5:25 pm

Hat/Ref: 7282

Time Promised:

2001 FORD EXCURSION LIMITED V8 7.3L 445CID FI DIESEL T F

VIN: 1FMSU43F11EB99192

License:

Mileage In: 228,713

Date Written: 06/01/2011

Unit #:

Mileage Out: 228,713

Written By: JASON

DOM:

Save Old Parts: No

Part	TF5360	TRANSFER CASE FLUID	3.00	8.99	26.97
------	--------	---------------------	------	------	-------

Job #14	FLUID LEAKING FROM REAR PINION	MATT			
Labor A	Work Requested - FLUID LEAKING FROM REAR PINION				74.00

Work Performed - FOUND REAR DIFFERENTIAL PINION SEAL FAILING. REPLACED REAR DIFFERENTIAL PINION SEAL AND REINSTALLED DRIVE SHAFT.

Job #15	TRANSMISSION SERVICE	MATT			
Labor A	Work Requested - TRANSMISSION SERVICE				111.00

Work Performed - FLUSHED FLUID FROM TRANSMISSION AND TORQUE CONVERTER, REPLACED TRANSMISSION FLUID, FILTER, AND TRANSMISSION PAN GASKET. RESEALED TRANSMISSION.

Part	58968	TRANSMISSION FILTER/GASKET KIT	1.00	65.84	65.84
Part	5360ATF	MERVON V TRANSMISSION FLUID	12.00	8.99	107.88

Job #16	REPLACE SHOCK ABSORBERS	MATT			
Labor A	Work Requested - REPLACE SHOCK ABSORBERS				148.00

Work Performed - REPLACED FRONT AND REAR SHOCK ABSORBERS

Part	911175	SHOCK ABSORBER	2.00	129.95	259.90
Part	911176	SHOCK ABSORBER	1.00	129.95	129.95

Job #17	HOOD LATCH STICKS	MATT			
Labor A	Work Requested - HOOD LATCH STICKS				37.00

Work Performed - FOUND LATCH DAMAGED. REPLACED HOOD LATCH ASSEMBLY

Part	4C3Z16700AA	HOOD LATCH	1.00	48.25	48.25
------	-------------	------------	------	-------	-------

Job #18	SHIFTER LEVER IS BROKEN	MATT			
Labor A	Work Requested - SHIFTER LEVER IS BROKEN				296.00

Work Performed - FOUND SHIFT LEVER HAS END BROKEN OFF AND IS LOOSE ON COLUMN. DISASSEMBLED STEERING COLUMN, FOUND PLUNGER AND SHAFT BROKEN. REPLACED STEERING COLUMN SHIFT PLUNGER AND SHAFT ASSEMBLY, REPLACED SHIFTER LEVER, REASSEMBLED STEERING COLUMN.

Part	1L3C7215AA	SHAFT	1.00	45.68	45.68
Part	3C3Z7A216BA	PLUNGER	1.00	37.52	37.52
Part	5C3Z7210AAA	SHIFTER LEVER	1.00	75.80	75.80

Job #19	AIR CONDITIONING BLOWS WARM	ED			
	AIR				

MIDWEST AUTOMOTIVE & DIESEL

Invoice

1306 N. PROSPECT

Champaign, IL 61820

Shop Phone: (217) 352-7343

Fax: (217) 352-7366

Email: MIDWESTAAD@AOL.COM

1858

Estimate Ref #0

Date Printed: 06/28/2011

Printed Time: 5:25 pm

Hat/Ref: 7282

Time Promised:

2001 FORD EXCURSION LIMITED V8 7.3L 445CID FI DIESEL T F

VIN: 1FMSU43F11EB99192

License:

Mileage In: 228,713

Date Written: 06/01/2011

Unit #:

Mileage Out: 228,713

Written By: JASON

DOM:

Save Old Parts: No

Labor A Work Requested - AIR CONDITIONING BLOWS WARM AIR 333.00

Work Performed - PERFORMED A/C SYSTEM DYE TEST, AND PRESSURE TEST. FOUND FREON LEAK FROM A/C CONDENSOR AND ACCUMULATOR CAUSING FREON TO BE EMPTY. REPLACED A/C ACCUMULATOR, CONDENSOR, EVAPORATOR CORE, ORIFICE FILTER, AND COMPRESSOR ASSEMBLY AS PER CUSTOMER REQUEST. RECHARGED FRONT AND REAR A/C WITH R134A REFRIDGERANT AND A/C SYSTEM IS NOW OPERATING AS DESIGNED.

Part DYE	A/C DYE	1.00	14.95	14.95
Part R134A	REFRIDGERANT	5.00	24.95	124.75
Part FOR54184	EVAPORATOR CORE	1.00	130.50	130.50
Part 210240	ACCUMULATOR	1.00	67.16	67.16
Part 4R3Z19703A	A/C COMPRESSOR ASSEMBLY	1.00	387.62	387.62
Part 38635	ORIFICE FILTER	1.00	6.92	6.92
Part GDR71160	CONDENSER	1.00	190.03	190.03

Job #20 FUEL LEAK FROM LEFT FRONT OF MATT
VEHICLE

Labor A Work Requested - FUEL LEAK FROM LEFT FRONT OF VEHICLE 74.00

Work Performed - FOUND FUEL LINES FROM LIFT PUMP TO ENGINE RUSTED AND HAVE A MINOR LEAK. REPLACED FUEL LINS FROM LIFT PUMP TO ENGINE.

Part 2C3Z9J338BA	FUEL LINE ASSEMBLY	1.00	179.85	179.85
------------------	--------------------	------	--------	--------

Job #21 REPLACE FUEL FILTER MATT

Labor A Work Requested - REPLACE FUEL FILTER 37.00

Work Performed - REPLACED FUEL FILTER ELEMENT

Part 33818	FUEL FILTER	1.00	74.95	74.95
------------	-------------	------	-------	-------

Job #22 FRONT BRAKE SERVICE MATT

Labor A Work Requested - FRONT BRAKE SERVICE 111.00

Work Performed - FOUND FRONT BRAKE PADS WORN AND ROTORS BELOW MINIMUM THICKNESS TO RESURFACE. CLEANED AND LUBED CALIPER SLIDES, REPLACED FRONT BRAKE PADS, FRONT BRAKE ROTORS AND REASSEMBLED.

Part BRKCLN	BRAKE PARTS SOLVENT	1.00	9.95	9.95
Part BR54078	BRAKE ROTOR	2.00	116.35	232.70
Part MX756	BRAKE PAD KIT	1.00	99.95	99.95
Part H5660Q	BRAKE HARDWARE	1.00	26.58	26.58

Job #23 REAR BRAKE SERVICE MATT

Labor A Work Requested - REAR BRAKE SERVICE 185.00

MIDWEST AUTOMOTIVE & DIESEL

1306 N. PROSPECT
 Champaign, IL 61820
 Shop Phone: (217) 352-7343
 Fax: (217) 352-7366
 Email: MIDWESTAAD@AOL.COM

Invoice

1858

Estimate Ref #0

Date Printed: 06/28/2011

Printed Time: 5:25 pm

Hat/Ref: 7282

Time Promised:

2001 FORD EXCURSION LIMITED V8 7.3L 445CID FI DIESEL T F

VIN: 1FMSU43F11EB99192

License:

Mileage In: 228,713

Date Written: 06/01/2011

Unit #:

Mileage Out: 228,713

Written By: JASON

DOM:

Save Old Parts: No

Work Performed - FOUND REAR BRAKE PADS WORN, ROTORS BELOW MINIMUM THICKNESS TO RESURFACE, ALSO FOUND REAR PARKING BRAKE SHOE FRICTION MATERIAL CRACKED AND FALLING APART. CLEANED AND LUBED CALIPER SLIDES, REPLACED REAR PARKING BRAKE SHOES, REAR BRAKE ROTORS, REAR BRAKE PADS, AND REASSEMBLED REAR BRAKES.

Part	FB771	PARKING BRAKE SHOE SET	1.00	102.69	102.69
Part	H7308	PARKING BRAKE HARDWARE	1.00	35.61	35.61
Part	BR54074	BRAKE ROTOR	2.00	148.57	297.14
Part	MX757	BRAKE PAD SET	1.00	99.95	99.95
Part	H5643Q	BRAKE PAD HARDWARE KIT	1.00	22.93	22.93

Job #24	BRAKE FLUID SERVICE	MATT			
Labor A	Work Requested - BRAKE FLUID SERVICE				74.00
	Work Performed - REMOVED OLD BRAKE FLUID, REPLACED BRAKE FLUID AND BLED LINES AT ALL 4 WHEELS				
Part	BF100	BRAKE FLUID	2.00	9.95	19.90

Job #25	REPLACE WINDSHIELD WIPER	MATT			
	BLADES				
Labor A	Work Requested - REPLACE WINDSHIELD WIPER				0.00
	BLADES				
	Work Performed - REPLACED BOTH FRONT AND REAR WINDSHIELD WIPER BLADES (NO LABOR)				
Part	3120	FRONT WIPER BLADE	2.00	12.95	25.90
Part	3115	REAR WIPER BLADE	1.00	12.95	12.95

Job #26	LEFT OUTSIDE MIRROR IS BROKEN	MATT			
Labor A	Work Requested - LEFT OUTSIDE MIRROR IS BROKEN				74.00
	Work Performed - REPLACED LEFT FRONT OUTSIDE POWER REAR VIEW MIRROR ASSEMBLY				
Part	3C7Z17683EAA	LEFT OUTSIDE MIRROR ASSEMBLY	1.00	434.07	434.07

Job #27	INSIDE AUTO DIMMING MIRROR IS	MATT			
	BROKEN				
Labor A	Work Requested - INSIDE AUTO DIMMING MIRROR IS				37.00
	BROKEN				
	Work Performed - REPLACED INSIDE WINDSHIELD MOUNTED REAR VIEW MIRROR ASSEMBLY				
Part	YC3Z17700AA	INSIDE REAR VIEW MIRROR	1.00	207.88	207.88

Job #28	RIGHT REAR POWER VENT	MATT			
	WINDOW WILL NOT OPEN				
Labor A	Work Requested - RIGHT REAR POWER VENT				148.00
	WINDOW WILL NOT OPEN				

MIDWEST AUTOMOTIVE & DIESEL

1306 N. PROSPECT
 Champaign, IL 61820
 Shop Phone: (217) 352-7343
 Fax: (217) 352-7366
 Email: MIDWESTAAD@AOL.COM

Invoice

1858

Estimate Ref #0
 Date Printed: 06/28/2011
 Printed Time: 5:25 pm

Hat/Ref: 7282

Time Promised:

2001 FORD EXCURSION LIMITED V8 7.3L 445CID FI DIESEL T F

VIN: 1FMSU43F11EB99192

License:

Mileage In: 228,713

Date Written: 06/01/2011

Unit #:

Mileage Out: 228,713

Written By: JASON

DOM:

Save Old Parts: No

Work Performed - FOUND POWER VENT WINDOW MOTOR FAILING. REPLACED RIGHT REAR POWER VENT WINDOW MOTOR ASSEMBLY

Part	YC3Z7830478AA	VENT WINDOW MOTOR/REGULATOR	1.00	71.33	71.33
------	---------------	-----------------------------	------	-------	-------

Job #29 FRONT POWER OUTLET / CIGAR ED
 LIGHTER IS INOPERA...
 Labor A Work Requested - FRONT POWER OUTLET / CIGAR 29.60
 LIGHTER IS INOPERATIVE

Work Performed - FOUND SOCKET SHORTED AND ELEMENT FAILING. REPLACED FRONT POWER OUTLET SOCKET AND ELEMENT

Part	XC3Z15055AA	SOCKET	1.00	14.10	14.10
Part	F7SZ15052AA	ELEMENT	1.00	9.21	9.21

Job #30 FRONT DOME LAMP IS MATT
 INOPERATIVE
 Labor A Work Requested - FRONT DOME LAMP IS 66.60
 INOPERATIVE

Work Performed - FOUND BULBS BURNT OUT, LENSE DAMAGED, AND CIRCUIT CONNECTOR DAMAGED. REPAIRED CIRCUIT CONNECTORS, REPLACED BULBS AND LENSE IN OVERHEAD CONSOLE

Part	F4DZ13783A	LENS	1.00	18.22	18.22
Part	XU5Z13466AA	BULB ASSEMBLY	2.00	9.98	19.96

Job #31 REAR WINDOW WASHER IS MATT
 INOPERATIVE
 Labor A Work Requested - REAR WINDOW WASHER IS 96.20
 INOPERATIVE

Work Performed - FOUND REAR WASHER LINE INSIDE VEHICLE SIDE WALL IS DETERIORATED AND LEAKS FLUID OUT BEFORE IT GETS TO THE WINDOW. REPAIRED REAR WASHER LINE AND SYSTEM IS NOW OPERATING AS DESIGNED

Part	BH501	HOSE	1.00	18.65	18.65
------	-------	------	------	-------	-------

Job #32 3RD BRAKE LIGHT, LISCENSE MATT
 LAMP, AND LEFT STEP...
 Labor A Work Requested - 3RD BRAKE LIGHT, LISCENSE LAMP, 66.60
 AND LEFT STEP ENTRY LAMP ARE ALL INOPERATIVE

Work Performed - FOUND ALL 3 LAMPS HAVE BULBS BURNT OUT IN THEM. REPLACED HIGH MOUNT BRAKE LIGHT BULBS, LISCENSE LAMP BULB, AND LEFT STEP ENTRY LAMP BULB. ALL ALMPs ARE NOW OPERATING AS DESIGNED

Part	194	BULB	2.00	4.90	9.80
Part	921	BULB	4.00	8.75	35.00

Job #33 CHECK ENGINE LIGHT COMES ON MATT

MIDWEST AUTOMOTIVE & DIESEL

1306 N. PROSPECT
 Champaign, IL 61820
 Shop Phone: (217) 352-7343
 Fax: (217) 352-7366
 Email: MIDWESTAAD@AOL.COM

Invoice

1858

Estimate Ref #0
 Date Printed: 06/28/2011
 Printed Time: 5:25 pm

Hat/Ref: 7282

Time Promised:

2001 FORD EXCURSION LIMITED V8 7.3L 445CID FI DIESEL T F

VIN: 1FMSU43F11EB99192

License:

Mileage In: 228,713

Date Written: 06/01/2011

Unit #:

Mileage Out: 228,713

Written By: JASON

DOM:

Save Old Parts: No

Labor A **Work Requested - CHECK ENGINE LIGHT COMES ON** **370.00**

Work Performed - VERIFIED CONCERN. PERFORMED EEC TESTS, RETRIEVED CODES FOR GLOW PLUG CONTROL CIRCUIT. PERFORMED DIESEL DIAGNOSTIC PINPOINT ELECTRICAL TESTS, FOUND GLOW PLUG CONTROL MODULE HAS AN INTERNAL FAULT CAUSING GLOW PLUGS TO FAIL. REPLACED ALL 8 ENGINE GLOW PLUGS, REPLACED GLOW PLUG CONTROL MODULE ASSEMBLY, RECALIBRATED SYSTEM TO CLEAR CODES AND SYSTEM IS NOW OPERATING AS DESIGNED

Part	F4TZ12A342BA	GLOW PLUG	8.00	17.42	139.36
Part	YC3Z12B533AA	GLOW PLUG CONTROL MODULE	1.00	193.17	193.17

Job #34 **LEFT SECOND ROW SEAT BELT** **MATT**

BUCKLE IS BROKEN OFF...

Labor A **Work Requested - LEFT SECOND ROW SEAT BELT BUCKLE IS BROKEN OFF AND POKING INTO SEAT COVER** **59.20**

Work Performed - REPLACED LEFT SIDE SECOND ROW SEAT BELT BUCKLE ASSEMBLY

Part	YC3Z7860045AAD	SEAT BELT BUCKLE ASSEMBLY	1.00	90.10	90.10
------	----------------	---------------------------	------	-------	-------

Job #35 **MOUNT AND BALANCE 4 NEW** **MATT**

TIRES

Labor A **Work Requested - MOUNT AND BALANCE 4 NEW TIRES** **111.00**

Work Performed - MOUNTED AND BALANCED 4 NEW "E" RATED TIRES AND INSTALLED AFTERMARKET TIRE PRESSURE MONITOR SYSTEM THAT WAS PROVIDED BY CUSTOMER

Part	LT265/75R16	UNIROYAL LAREDO HDH E- RATED TIRE	4.00	198.00	792.00
Part	WW/DISP/TT	WHEEL WEIGHTS/TIRE DISPOSAL/TIRE TAX	4.00	7.50	30.00

Job #36 **WHEEL ALIGNMENT** **MATT**

Labor A **Work Requested - WHEEL ALIGNMENT** **99.95**

Job #37 **INSTALL LAPTOP HOLDER IN** **MATT**

FRONT PASSENGER SEAT...

Labor A **Work Requested - INSTALL LAPTOP HOLDER IN FRONT PASSENGER SEAT AREA, MODIFY AND INSTALL 2 ROOF ANTENNAS AND FABRICATE BRACKETS TO ATTACH TO ROOF RACK** **148.00**

Part	HDWR	HARDWARE	1.00	18.90	18.90
Part	75830	HITCH PIN	1.00	6.75	6.75

Job #38 **MATT**

Sublet **Work Requested - COMPLETE VEHICLE DETAIL** **1.00** **169.95** **169.95**

Work Performed - COMPLETE VEHICLE DETAIL

MIDWEST AUTOMOTIVE & DIESEL

1306 N. PROSPECT
Champaign, IL 61820
Shop Phone: (217) 352-7343
Fax: (217) 352-7366
Email: MIDWESTAAD@AOL.COM

Invoice

1858

Estimate Ref #0
Date Printed: 06/28/2011
Printed Time: 5:25 pm

Hat/Ref: 7262

Time Promised:

2001 FORD EXCURSION LIMITED V8 7.3L 445CID FI DIESEL T F
VIN: 1FMSU43F11EB99192

License:

Mileage In: 228,713

Date Written: 06/01/2011

Unit #:

Mileage Out: 228,713

Written By: JASON

DOM:

Save Old Parts: No

Revision History

Revision#	Date	Authorized By	Phone # / In Person
753	6/28/2011 5:23:58 PM	JUSTIN	SAME
Reason:			Additional Cost \$ 16,419.74

Original Estimate: \$ 513.11

Total Revisions: \$ 16,419.74

Current Estimate: \$ 16,416.66

MIDWEST AUTOMOTIVE & DIESEL

1306 N. PROSPECT
 Champaign, IL 61820
 Shop Phone: (217) 352-7343
 Fax: (217) 352-7366
 Email: MIDWESTAAD@AOL.COM

Invoice

1858

Estimate Ref #0
 Date Printed: 06/28/2011
 Printed Time: 5:25 pm

Hat/Ref: 7282

Time Promised:

2001 FORD EXCURSION LIMITED V8 7.3L 445CID FI DIESEL T F
 VIN: 1FMSU43F11EB99192

License: Mileage In: 228,713
 Unit #: Mileage Out: 228,713
 DOM:

Date Written: 06/01/2011
 Written By: JASON
 Save Old Parts: No

Payment Date	Type	Method	Amount
Payment Totals:			PAID
			JUN 29 2011
		

Parts: \$8,430.40
 Labor: \$6,819.90
 Sublet: \$304.95
 Misc: \$0.00

Hazmat: \$0.00
 Supplies: \$123.75
 Tax: \$737.66

Invoice Total: **\$16,416.66**

THANK YOU FOR YOUR BUSINESS

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto.

Authorized By _____

Date _____

Time _____